CAPSULE SUMMARY
BA-1528 BA-1/83
St. Stephens Church
8026-8030 Bradshaw Road
Bradshaw, Baltimore County
1889, 1895
Private

The buildings located on the vast campus of St. Stephens Church include the Gothic Revival style church, which was constructed in 1889, the circa 1895 rectory, a circa 1940 convent, and a circa 1970 school. The church and congregation date to a late-19th century period of settlement in the community of Upper Falls. The 1850 county atlas indicates that the community of Upper Falls, sited at the intersection of Bradshaw Road and Raphel Road was just beginning to take shape in the mid-19th century. Between 1850 and 1877, a Methodist Episcopal church, general store, and school were constructed at the center of the community. The 1877 county atlas also indicates that an earlier church associated with the St. Stephens congregation had already been constructed along Bradshaw Road. In 1889, the extant church was erected as a replacement of the earlier building. Prior documentation on the property indicates that the neighboring rectory was constructed shortly thereafter, in 1895, as a replacement of an earlier building that had been destroyed by fire. The new building was fitted with all contemporary conveniences, including plumbing and speaking tubes.

The cornerstone on this Gothic Revival style church reads, "His Eminence Cardinal Gibbons, Ordinary, Reverend Don Luigi Sarturi, Pastor, May 19, 1889. Dedicated June 15, 1890." The church stands two stories tall and three bays wide with a front gable slate roof and a gabled parapet. Built of random rubble stone, the building has brick accents including six-course brick quoins. A square tower with a steep pyramidal roof dominates the northwest end of the facade. All of the windows have molded wood surrounds and rock-faced stone sills. The central bay contains a round multi-light window with wood angular tracery and a brick lintel surround. The gable end is clad with brick and pierced with three, rectangular stained-glass windows that are fixed. The double-leaf entry has paneled wood doors made with diagonal board and is surrounded by a brick lintel and brick tympanum. Two interior end brick chimneys rise on either side of the gable roof.

Located northwest of the church is a circa 1895 parsonage. This Colonial Revival style building stands two-stories tall and three bays wide. The poured concrete foundation supports a wood frame structure clad with asbestos shingles. The hipped roof has slate tiles and is pierced by a central-interior brick chimney. Three single-leaf doors symmetrically pierce the first floor of the façade. The outer two wood doors are paneled with lights while the central wood door is paneled. These entrances are protected by a half-hipped porch that spans three bays with square column supports.

# Maryland Historical Trust Maryland Inventory of Historic Properties Form

Inventory No. BA-1528

1. Name of I	Property	(indicate preferred	name)				
historic	St. Stephen's Cl	hurch					
other							
2. Location							
street and number	<del>-8026-</del> 8030 Brad	dshaw Road				not for	publication
city, town	Bradshaw					vicinity	/
county	Baltimore Cour	nty					
3. Owner of	Property	(give names and mailin	g addresses of	all owners	)		
name	St. Stephen's Cl	hurch					
street and number	8030 Bradshaw	Road		_	telephone	Not Ava	ilable
city, town	Bradshaw		state MI	)	zip code	21021	
Contri Contri Deterr Deterr Recor	buting Resource i buting Resource i mined Eligible for mined Ineligible for ded by HABS/HA ic Structure Repor	rt or Research Report at MH	and Register yland Register				
6. Classifica	tion.						
Category districtXbuilding(s)structuresiteobject	Ownership —publicX_privateboth	Current Function agriculturecommerce/tradedefensedomestic _X_education _X_funerarygovernmenthealth careindustry	X_religionsocialtranspowork inunknow	on/culture rtation progress		ng No	ncontributing  buildings sites structure objects 3 Total  tting Resources the Inventory

-	-					
1	De	CC	rır	11	$\alpha$	n
		30		,,,	U	

Inventory No. BA-1528

	_				-	_		
- 1	c	-	-	ᆈ			-	-
- 1		n	п	а	и	ш	n	п

excellent X good	deteriorated ruins		
fair	altered		

Prepare both a one paragraph summary and a comprehensive description of the resource and its various elements as it exists today.

Constructed circa 1889, St. Stephen's Church fronts southwest on a large campus. The cornerstone on this Gothic Revival style church reads, "His Eminence Cardinal Gibbons, Ordinary, Reverend Don Luigi Sarturi, Pastor, May 19, 1889. Dedicated June 15, 1890." The church stands two stories tall and three bays wide with a front gable slate roof and a gabled parapet. Built of random rubble stone, the building has brick accents including six-course brick quoins. A square tower with a steep pyramidal roof dominates the northwest end of the facade. Each of the four sides of the tower features a triangular gabled dormer and three grouped louvered vents with pointed-arches and brick lintels. Spanning the façade are eight leaded stained glass windows that are double-hung with a pointed arch and row-lock brick lintels. All of the windows have molded wood surrounds and rock-faced stone sills. The central bay contains a round multi-light window with wood angular tracery and a brick lintel surround. The gable end is clad with brick and pierced with three, rectangular stained-glass windows that are fixed. The double-leaf entry has paneled wood doors made with diagonal board and is surrounded by a brick lintel and brick tympanum. Two interior end brick chimneys rise on either side of the gable roof. On the rear is a five-sided projecting bay flanked with two, gabled entries.

Located northwest of the church is a circa 1895 rectory. This Colonial Revival style building stands two-stories tall and three bays wide. The poured concrete foundation supports a wood frame structure clad with asbestos shingles. The hipped roof has slate tiles and is pierced by a central-interior brick chimney. The façade is pierced with three 1/1 aluminum windows with square-edged aluminum sills and surrounds on the second story. Three single-leaf doors symmetrically pierce the first floor of the façade. The outer two wood doors are paneled with lights while the central wood door is paneled. These entrances are protected by a half-hipped porch that spans three bays with square column supports.

Located northeast of the church is a circa 1940 convent built in the Colonial Revival style. This three-story building has a raised foundation that supports a wood frame structure with a brick veneer. The façade of this five-bay house is pierced with eleven 6/6 windows with square-edged wood sills and surrounds. The single-leaf entry is centrally placed with a wood door that is paneled with lights and a one-light transom. The asphalt shingle front gable roof is accented with an exterior end brick chimney and pedimented gable ends.

Located northeast of the parsonage is a cemetery containing approximately 200 graves. With the earliest headstone dating to 1833, this cemetery set on sloping grassy lot is still in use. The headstones range from granite to marble with a variety of styles including obelisks, crosses, statuesque, and floral. Some of the family names include Bradley, McWilliams, Whitmore, Mohmonier, Doyle, Raphel, and Rembold.

A circa 1940 shed features a poured concrete foundation, wood-shingle-clad structure, and two, roll-up doors. The uneven gable roof has overhanging eaves and exposed ends.

Located behind the convent is a circa 1970 school with a flat roof. This wood frame structure is clad in five-course American bond brick. The concrete entrance portico contains a double-leaf metal door that is flush with

## Maryland Historical Trust Maryland Inventory of Historic Properties Form

BA-1/83 Inventory No. BA-1528

Name St. Stephen's Church, 8026-8030 Bradshaw Road, Bradshaw, Baltimore County Continuation Sheet

Number 7 Page 1

lights. The façade is pierced with a complicated fenestration pattern including 1/1, 2/2, and five-light fixed over a one-light hopper windows.

Located next to the school is a circa 1990 office with a flat roof. The wood frame building is clad with pressed vertical board. Five 1/1 vinyl windows pierce the façade as well as two single-leaf metal doors that are flush with lights.

8. Signification	ance			Inventory No. BA 1528-
Period	Areas of Significance	Check and j	ustify below	
1600-1699 1700-1799 X 1800-1899 X 1900-1999 2000-	agriculture archeology X architecture art commerce communications community planning conservation	<ul> <li>economics</li> <li>education</li> <li>engineering</li> <li>entertainment/</li> <li>recreation</li> <li>ethnic heritage</li> <li>exploration/</li> <li>settlement</li> </ul>	<ul> <li>health/medicine</li> <li>industry</li> <li>invention</li> <li>landscape archit</li> <li>law</li> <li>literature</li> <li>maritime history</li> <li>military</li> </ul>	performing arts philosophy politics/government recture X religion science social history transportation other:
Specific dates	1895-present		Architect/Builder	Edward Reynolds, builder
Construction da	ites 1889, 1895 ca.			
Evaluation for:				
	National Register	N	Maryland Register	Xnot evaluated

Prepare a one-paragraph summary statement of significance addressing applicable criteria, followed by a narrative discussion of the history of the resource and its context. (For compliance projects, complete evaluation on a DOE Form – see manual.)

The buildings located on the vast campus of St. Stephens Church include the Gothic Revival style church, which was constructed in 1889, the circa 1895 rectory, a circa 1940 convent, and a circa 1970 school. The church and congregation date to a late-19<sup>th</sup> century period of settlement in the Eleventh District community of Upper Falls. The 1850 county atlas indicates that the community of Upper Falls, sited at the intersection of Bradshaw Road and Raphel Road was just beginning to take shape in the mid-19<sup>th</sup> century. Rather than a concentration of structures centered on the crossroads, a group of buildings scattered along the two roads comprised the small village. Between 1850 and 1877, a Methodist Episcopal church, general store, and school were constructed at the center of the community. The1877 county atlas also indicates that an earlier church associated with the St. Stephens congregation had already been constructed along Bradshaw Road. In 1889, the extant church was erected as a replacement of the earlier building. Prior documentation on the property indicates that the neighboring rectory was constructed shortly thereafter, in 1895, as a replacement of an earlier building that had been destroyed by fire. The new building was fitted with all contemporary conveniences, including plumbing and speaking tubes.

<sup>&</sup>lt;sup>1</sup> J.C. Sidney, Map of the City and County of Baltimore, Maryland, from Original Surveys (Baltimore, MD: James M. Stephens, 1850).

<sup>2</sup> Atlas of Baltimore County, Maryland (Philadelphia, PA: G.M. Hopkins, 1877).

<sup>&</sup>lt;sup>3</sup> Baltimore County Historic Inventory.

### 9. Major Bibliographical References

Inventory No. BA-1528

Atlas of Baltimore County, Maryland. Philadelphia, PA: G. M. Hopkins, 1877.

Baltimore County Historic Inventory.

Brooks, Neal A. and Eric G. Rockel. A History of Baltimore County. Towson, MD: Friends of the Towson Library, Inc., 1979. Map of Baltimore County. Philadelphia, PA: G. W. Bromley, 1915.

Scharf, J. Thomas. History of Baltimore City and County From the Earliest Period to the Present Day: Including Biographical Sketches of Their Representative Men. Philadelphia, PA: Louis H. Everts, 1881. Reprinted by Higginson Book Company, Salem, MA.

Sidney, J. C. Map of the City and County of Baltimore, Maryland, from Original Surveys. Baltimore, MD: James M. Stephens, 1850.

#### 10. Geographical Data

Acreage of surveyed property _	Two Acres		
Acreage of historical setting	Unknown		
Quadrangle name	White Marsh	Quadrangle scale:	1:24,000
**************************************		55 CONTROL OF VALUE O	

#### Verbal boundary description and justification

Since 1889, the buildings on the property occupied by St. Stephen's Church have been associated with the fifteen acres of land known as tax parcel 500 of map 64 located in the Baltimore County Tax Assessor's office.

#### 11. Form Prepared by


name/title	A. McDonald and A. Didden, Architectural Historians		
organization	EHT Traceries, Incorporated	date	May 29, 2001
street & number	1121 5th Street NW	telephone	202.393.1199
city or town	Washington	state	DC


The Maryland Inventory of Historic Properties was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust DHCD/DHCP 100 Community Place Crownsville, MD 21032-2023 410-514-7600

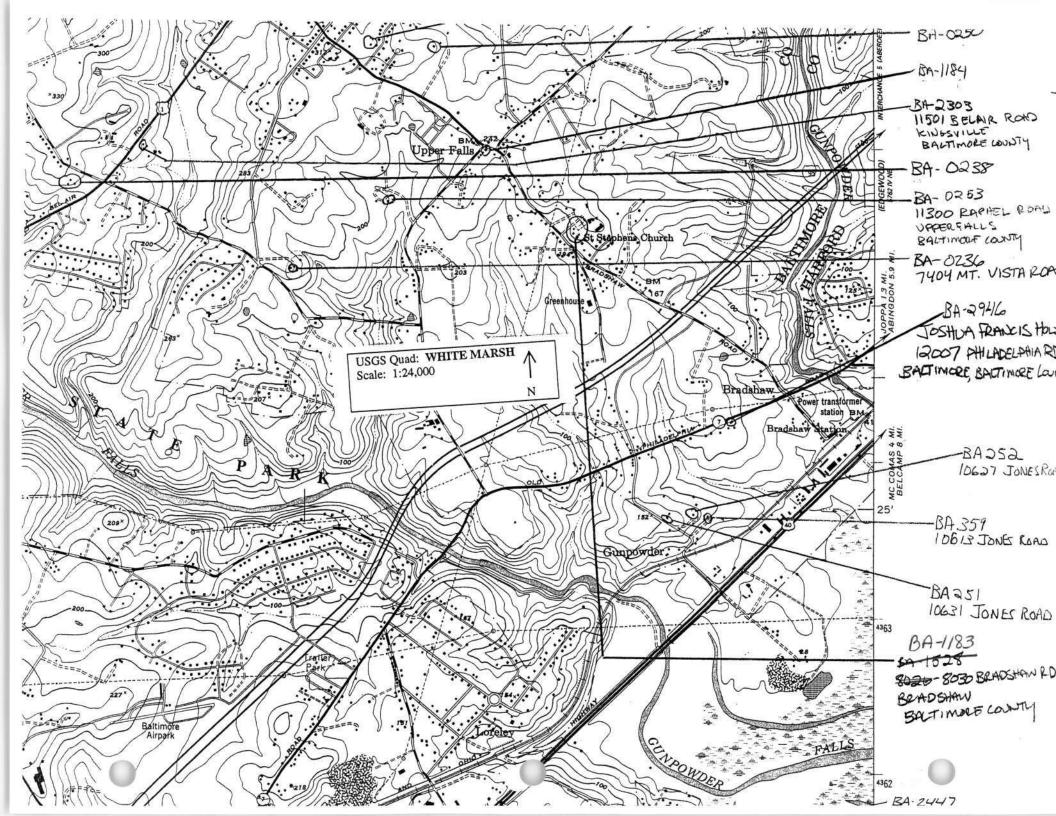

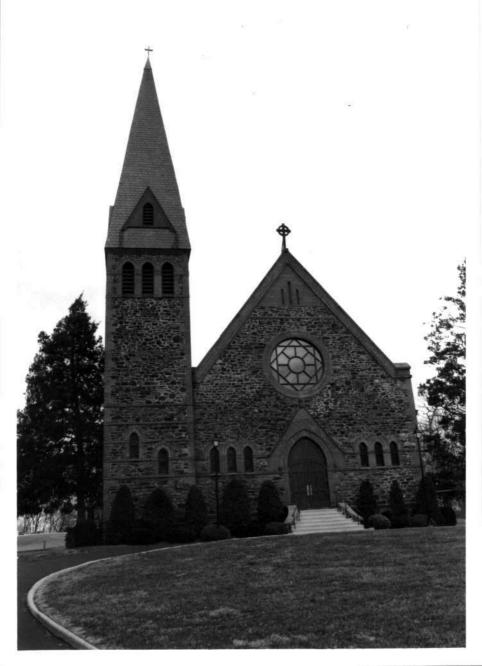


BA-1183 8006-8030 BRADSHAW ROAD BREADSHAW

TRACTRIES 412001

BALTIMORE LOUNTY , MO

SW GLEVATION

MD-SHPO

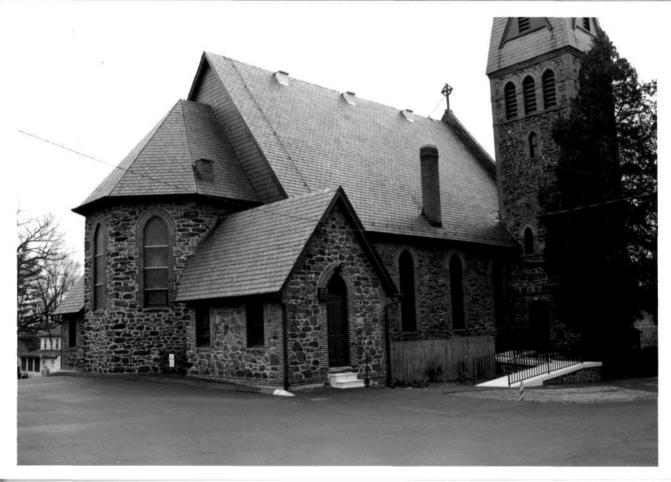

BA-1183

QDDG-8030 BRADSHAW ROAD

BRADSHAW

BALTIMERE CONTY, MD


TRACTERS

412001

MD-SHED

N CORNER

2 2 8

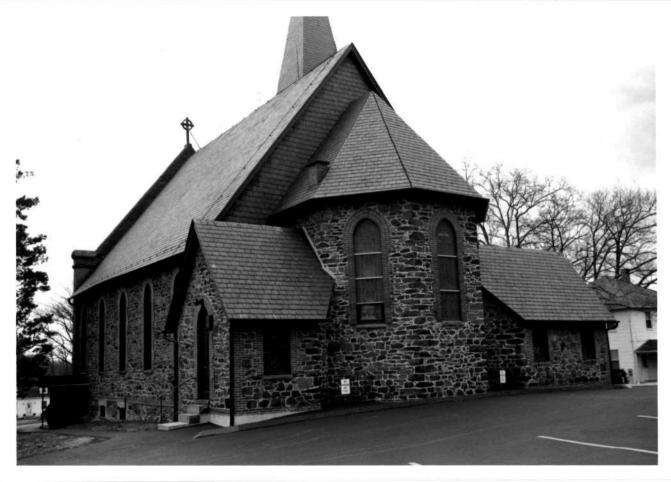

BA-1183

4/200)

MO-SHPO

E LOENER

BRADSHAW BALTIMOLE COUNTY, MD

TRACERIES

8026-8030 BRADSHAW ROAD



BAN 183 8026-8030 BRADSHAW ROAD BANNINGE CONTY, WD

MO-SHOU (PASONGE)

4 28

TEALFERS



BA-1183 8026-8030 BRADSHAW ROAD BRADSHAW

BRADSHAW BALTIMORE COUNTY, MD TRALBRIES

MD-SHED

E COENER PARSONAGE

89



BA-1183
8026-8030 BRADSHAW ROAD
BRADSHAW
BALTIMORF WINTYIMD
TRACTRIES
410001

MD-SHPD

7 48

SCHOOL & CONTENT



BA-1183 8026-8030 BRADSHAW ROAD BRADSHAW BALTIMORE COUNTY, IMD TRACTRIES 4/2001 MD-SHPD

rf8

LEMETERY.

ST. STEPHEN'S CATHOLIC CHURCH - 1889 - North side of (No. 8030) Bradshaw Road, west of Pfeiffer Road. Church in Gothic style, built of a local red stone; 57 x 76 feet; doors and windows ornamented with brick. Rose window in main facade. Square corner tower with open belfry and spire. Designed by Baltimore architect Thomas C. Kennedy. Serious fire damage to pews and paneling in December 1973, but restored. Another fire caused by the furnace, On Jan. 28, 1986.